Qty:

Each

1 Um:

: BASKET BASE ASSEMBLY (350)

: D2221

: N/A

: F/B1

: 17NY

: 8/7/2006

: D2221/D2235

Monday, 7/31/2006 12:49:50 PM

User:

Kim Johnston

Process Sheet

Drawing Name

Part Number

Material

Due Date

Drawing Number

Project Number

Drawing Revision

Customer

: CU-DAR001 Dart Helicopters Services

Job Number **Estimate Number**

: 28036A

: 10189

P.O. Number

:NA

This Issue

: 7/31/2006

Prsht Rev.

Previous Run

First Issue

: NIA

Type : LARGE FAB ASSY

: 27997A

Written By Checked & Approved By

Comment

Added D3442-1KJ/JLM

S.O. No. : NA

Additional Product

Job Number:



Seq. #:

Machine Or Operation:

Description:

1.0

2.0

D31661

Basket Hoop

Comment: Qty.:

Pick:

4.0000 Each(s)/Unit Total:

4.0000 Each(s)

D22323

Qty Part Number

D3166-1

Description Batch

<u>8267 17 -> 2</u>

627846.

RIB

Basket Hinge

06-08-09

0b-08-09

Comment: Qty.:

2.0000 Each(s)/Unit Total:

2.0000 Each(s)

Pick:

Qty Part Number

Description Batch

2 D2232-3 Hinge bracket <u>B3452)</u>

Support Gusset (350 Bask

3.0

D2325

4.0000 Each(s)/Unit Total:

4.0000 Each(s)

Comment: Qty.: Pick:

Qty Part Number

4 D2325

Description Batch Support Gusset 631582

4.0

D23273

Spacer Bushing

Comment: Qty.:

2.0000 Each(s)/Unit Total:

2.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

2 D2327-3 Bushing

627051

<u>06-08-09</u>

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES							
DATE	STEP		PROCEDURE CHANGE	Ву	Date	Qty	Approval Mfg / Design Mgr	Approval QC inspector	
1.									
·		4							

NCR:			WORK ORDER NON-CONFORMANCE (NCR)							
		Description of NC		Corrective Action Section B		Verification	Approval Design Mgr	Approval		
DATE	ATE STEP	Section A	Initial Design Mgr	Action Description Design Mgr	Sign & Date	Section C		Approval QC inspector		
		, Ame								
		n.								
		/ *								
		K. gerrie					ļ			
		•) E			
				¥.						

Part No:	PAR #:	Fault Category:	NCR:	Yes	No	DQA:	Date:
NOTE: Date & initial all entries				QA: N	I/C C	losed:	Date:

Date: Monday, 7/31/2006 12:49:50 PM User: Kim Johnston **Process Sheet** Customer: CU-DAR001 Dart Helicopters Services Drawing Name: BASKET BASE ASSEMBLY (350) Job Number: 28036A Part Number: D2221 Job Number: Seq. #: **Machine Or Operation:** Description: Mounting Bracket 5.0 D2581 Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s) Pick: **Qty Part Number** Description Batch Mounting Bracket Ba7524 0b-08-22 2 D2581 D34421 6.0 Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s) Pick: Qty Part Number Description Batch B26139 2 D3442-1 Shim 7.0 M304EX07516F Expanded Metal Flat Stai Comment: Qty.: 39.6900 sf(s) 39.6900 sf(s)/Unit Total: Pick: **Qty Part Number** Description Batch **MIOIJOJ** M304EX0.75-16F Expanded Metal 8.0 M304TS0750W065 304 SQ Tube.75x.75x.065W Comment: Qty.: 29.4000 f(s)/Unit Total: 29.4000 f(s) Pick: 3/4" x 3/4" x 0.063 wall 304/316 SStubing Batch: **MIOI** 561 LARGE FAB 1 9.0 LARGE FABRICATION RESOURCE 1 Comment: LARGE FABRICATION RESOURCE 1 1-Cut D2235-1 Rib from D3166-1 Rib As Per Dwg D2235 2-Drill hole in D2221-3 as per Dwg D2221 3-Deburr 4-Remove all markings on material before welding

5-Weld as per Dwg D2221 using Welding Table and corner JigDeburr as required

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES								
DATE	STEP	PROCEDURE CHANGE	B	/	Date	Qty	Approval Mfg / Design Mgr	Approval QC Inspector		
				10.						
		·								
		·								

NCR:			WORK ORDER NON-CONFORMANCE (NCR)								
		Description of NC		Corrective Action Section B			A	Approval			
DATE	STEP	Section A		Approval Design Mgr	Approval QC Inspector						
					Y	<u> </u>					
	·	~		Ť.							
		110000000000000000000000000000000000000									
		8									

Part No:	PAR #:	Fault Category: I	NCR:	Yes No DQA:	Date: <u>06/08</u>] 87
NOTE: Date & initial all entries				QA: N/C Closed:	Date:

Monday, 7/31/2006 12:49:50 PM Date: User: Kim Johnston **Process Sheet** Drawing Name: BASKET BASE ASSEMBLY (350) Customer: CU-DAR001 Dart Helicopters Services Job Number: 28036A Part Number: D2221 Job Number: Seq. #: Machine Or Operation: Description: DDIMENSIONAL & WELDING INSPECTION 10.0 QC9/6 Comment: DDIMENSIONAL & WELDING INSPECTION 11.0 POWDER COATING POWDER COATING Comment: POWDER COATING Powder Coat White Gloss (Ref: 4.3.5.1) as per QSI 005 4.3 12.0 INSPECT POWDER COAT/CHEMICAL CONVERSION QC3 Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION 13.0 HAND FINISHING RESOURCE #1 Comment: HAND FINISHING RESOURCE #1 Seal support gusset seam with white sikaflex-291 Batch: M 101855 Expiry date: <u>031200</u> 7 14.0 DC DOCUMENT CONTROL Comment: DOCUMENT CONTROL Inspection Level 21 Job Completion

Dart A	erospac	e Ltd							
W/O:			WC	RK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE			Ву	Date	Qty	Approval Mfg / Design Mgr	Approval QC Inspector
								-	
NCR:			WORK ORDE	ER NON-CONFORMANO	CE (NCF	₹)			
		Description of NC	Description of NC Corrective Action Section B				ation	Approval	Approval
DATE	STEP	Section A	Initial Design Mgr	Action Description Design Mgr	Sign 8 Date	Sign & Section		Design Mgr	Approval QC Inspector
	1	White the state of							

Part No:	PAR #:	Fault Category:	NCR: Yes No DQA:	Date:



	DESIG	BW	DRAWN BY	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA
	CHEC	KED	APPROVED 44	DRAWING NO. REV. F
Ì		A	洲	D2221 SHEET 1 OF 3
	DATE			TITLE SCALE
	05.0	06.07		BASKET BASE ASSEMBLY (350) NTS
	С		95.11.21	SEPARATE BASKET AND LID
	D		96.06.21	CHANGE LATCH
	Ε	2	01.04.19	CHANGE HINGE
	F		05.06.07	ADD SHIM UNDER HINGES, ADD HOLES FOR SPLIT LID BASKETS

RELEASED 05.08.19

PARTS LIST FOR D2221 BASKET BASE ASSEMBLY

PART NO	QUANTITY	LENGTH	LENGTH	DESCRIPTION
		Α	В	
D2221-1	2.		96.00	RIB
D2221-3	2		25.50	RIB
D2221-5	2	18.88		RIB
D2221-7	1	55.25	***************************************	RIB
D2232-3	2	N/A	N/A	HINGE PLATE
D2235-1	4	N/A	N/A	RIB
D2325	4	N/A	N/A	SUPPORT GUSSET
D2327-3	2	N/A	N/A	BUSHING
D2581	2	N/A	N/A	MTG BRKT
D3442-1	2	N/A	N/A	SHIM

SHOP COPY RETURN TO ENGINEERING UNCONTROLLED COPY. 45° SUBJECT TO AMENDMEN

WITHOUT NOTICE WORK ORDER

D2221-1/-3/-5/-7


CUT LENGTH/SHAPE PER DIAGRAM AND PARTS LIST

MATERIAL: AISI 304/316 SS, 3/4 X 3/4 X 0.060 WALL SQUARE TUBING (REF. DART SPEC M304TS0.750W.060)

- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- ALL DIMENSIONS ARE IN INCHES
- DRILL Ø0.257 HOLES ONLY WHEN ASSEMBLING D2221 BASE WITH D2989-041/-043 BASKET LID


Copyright © 1994 by DART AEROSPACE LTD

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

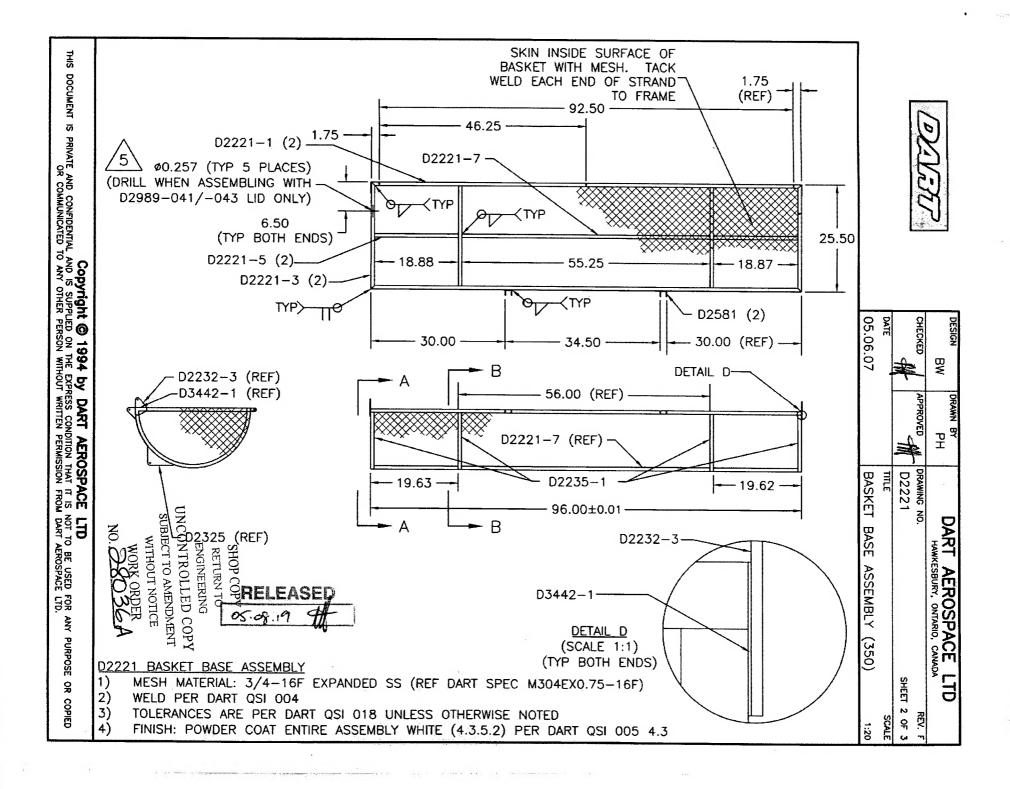




BW DRAWN BY PH			DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA		
ı	CHECKED	APPROVED AN	DRAWING NO.	REV.	F
	#	#	D2221 SHEET	3 OF	3
I	DATE		TITLE	SCAL	E
	05.06.07		BASKET BASE ASSEMBLY (350)	1:	:8

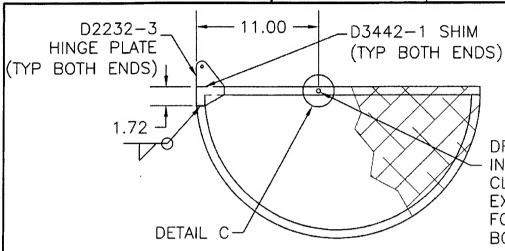

DRILL 3/8 HOLE AND INSTALL D2327-3 USING CLOSEST SPACE IN EXPANDED METAL FOR HOLE LOCATION BOTH ENDS

SECTION A-A SAME BOTH END RIBS

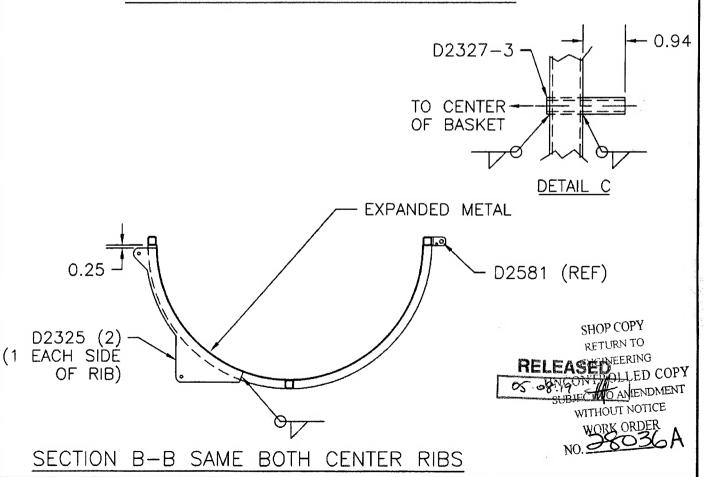

Copyright © 1994 by DART AEROSPACE LTD

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

